

Sonnax Breaks the Codes

**Puzzled by P0741 or P1811 codes?
Sonnax has the answers.**

5. TH440.VA10



**Oversized 1-2 (Forward) or
Reverse Servo Boost Valve Kit**

Helps cure:

- Delayed engagements
- Flared 1-2 shift
- Low reverse pressure

Note: Requires tool kits **84754-TL2**

6. 4T60E.VA13

3-4 Shift

4T60E.VA14

4-3 Downshift

7. 4T60E.VA11

2-3 Shift

4T60E.VA12

3-2 Downshift

Shift Valves

Helps cure:

- Erratic or temperature-sensitive shifts
- 2nd gear start
- 2-3 shuttle shift
- No 3rd or 4th gear

8. 84596-02K



AFL Valve & Sleeve Kit

Helps cure:

- Code 1811
- Maximum adapt or long shift
- TCC slippage

Note: Requires tool kit **F-84596-TL**
& the **VB-FIX** reaming fixture




More information is available
at **www.sonnax.com**

8. Located in Channel Plate



for Your 4T65-E Valve Body

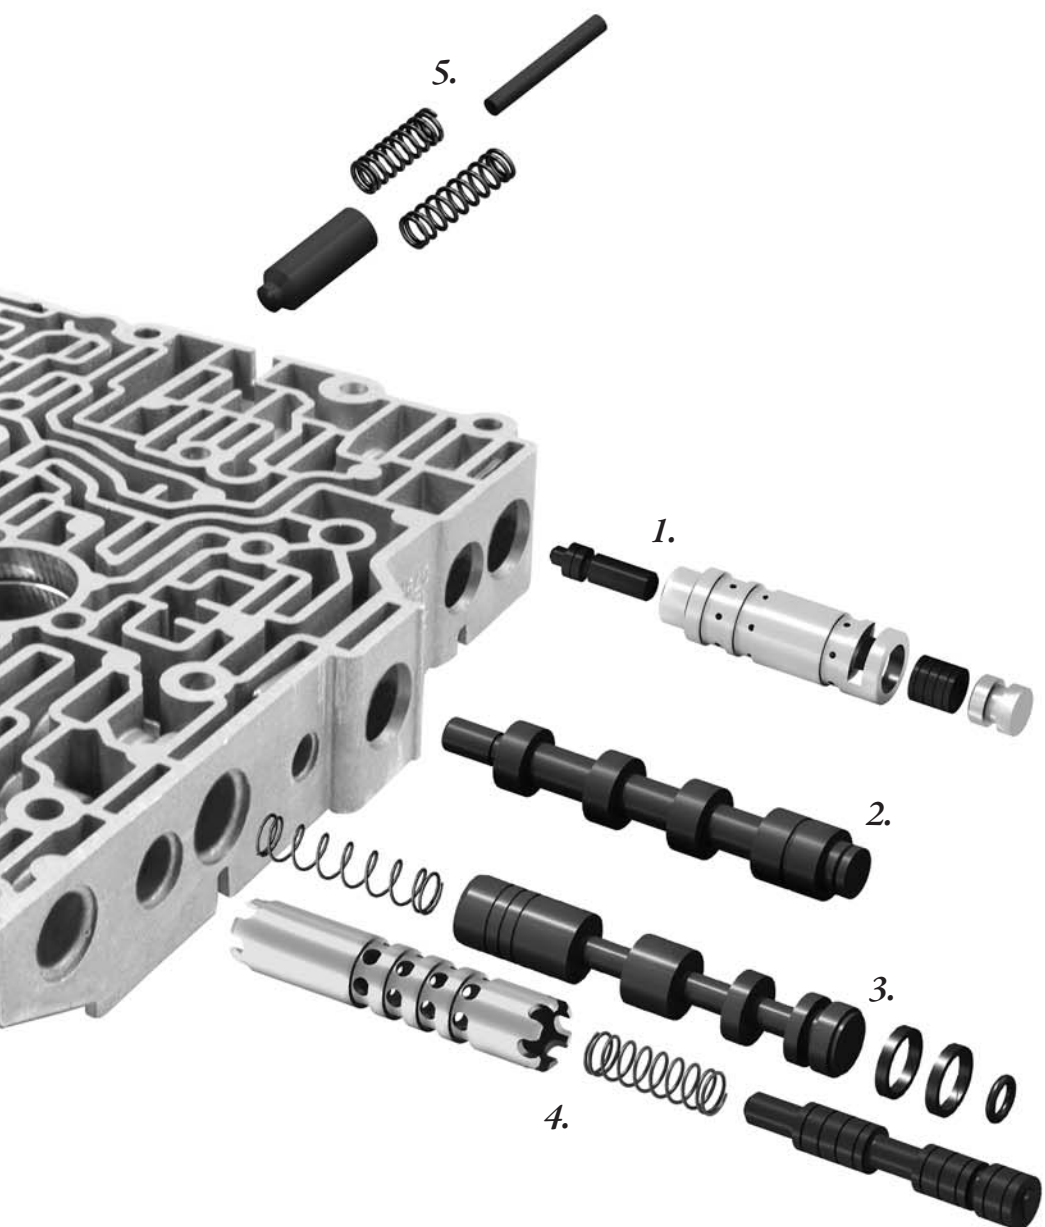

1. 4T65E.VA01

Boost Valve & Sleeve Assembly Kit

Helps cure:

- Harsh reverse engagement
- Soft upshifts, especially 1-2
- Low line pressure, forward or reverse

2. 84754-44

Oversized Torque Signal Valve



Helps cure:

- 1811 Code
- Poor or intermittent line rise
- Slip/shudder condition

Note: Requires tool kit 84754-TL44

3. 4T65E.VA03

4T65E.VA05

Standard
Oversized

TCC Apply Valve Kit



Helps cure:

- Code 741
- No lockup
- Falling out of lockup hot



Note: 84754-50K requires tool kit F-84754-TL50 & reaming fixture VB-FIX.

4. 4T65E.VA02

TCC Regulated Apply Valve Kit



Helps cure:

- TCC slip
- Code 741
- Ratio codes

Note: Requires tool kit 84754-TL3

sonnax®
TIME TESTED • INDUSTRY TRUSTED®

Automatic Drive • P.O. Box 440 • Bellows Falls, Vermont 05101-0440 USA
800-843-2600 • 802-463-9722 • F: 802-463-4059 • www.sonnax.com • info@sonnax.com

©2008 Sonnax Industries, Inc.