

5R55W/S Out of control?


1. 56947J-05K

Oversized TCC Control Valve Kit

Helps cure:

- Excess TCC slip, Code 741
- TCC lining comes off
- Overheated converters

Note: Requires tool kit F-56947J-TL2 & the VB-FIX reaming fixture

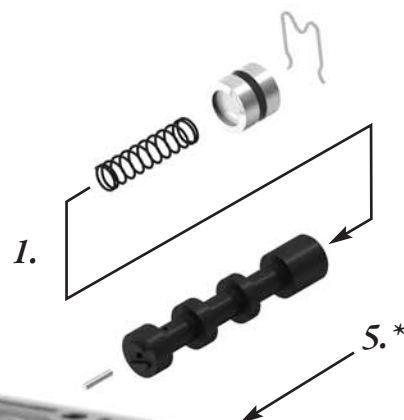


2. 5R55N.VA03

TCC Modulator Valve & Sleeve

Helps cure:

- Excess TCC slippage
- Codes 741 & 1783
- Transmission over temperature conditions

Note: Requires tool kit 5R55N.VA04 & the AG4.VA05 reaming fixture

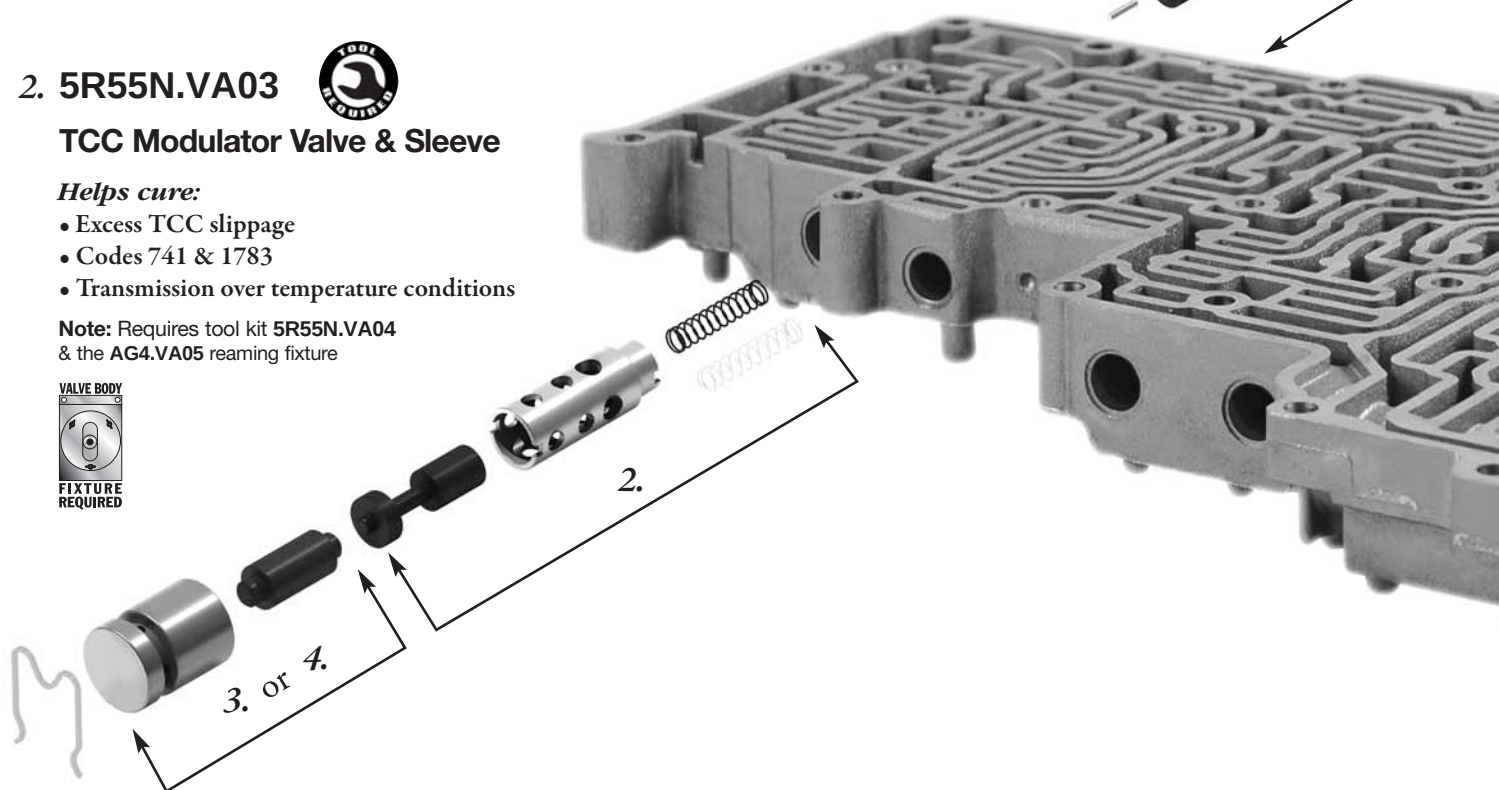

3. 5R55W.VA01 Increased Ratio

4. 5R55W.VA02 OEM Ratio

TCC Modulator Sleeve & Plunger Assemblies


Helps cure:

- High TCC slip RPM at increasing load
- Slip codes
- Elevated fluid temperature



Sonnax has the answer!

Six Sonnax kits allow you to repair the most common areas of valve body wear and restore pressure control.

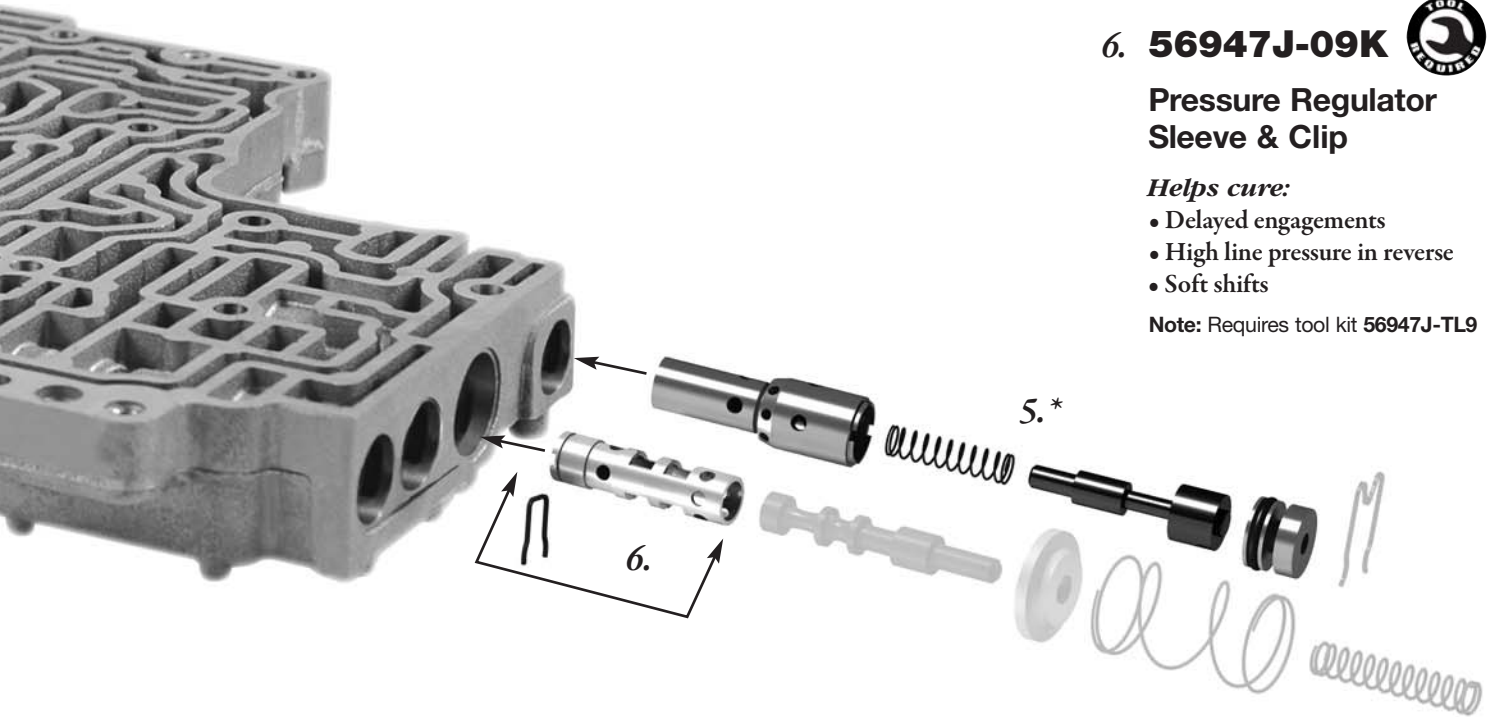

5. 5R55W.VA03

**Two Locations*



VFS Modulator Control Sleeve & Valve Kit

Helps cure:

- Line pressure concerns
- Slipping upshifts
- Low line pressure



Note: Requires tool kit 5R55W.VA04 & the AG4.VA05 reaming fixture

6. 56947J-09K



Pressure Regulator Sleeve & Clip

Helps cure:

- Delayed engagements
- High line pressure in reverse
- Soft shifts

Note: Requires tool kit 56947J-TL9

sonnax®
TIME TESTED • INDUSTRY TRUSTED®

Automatic Drive • P.O. Box 440 • Bellows Falls, Vermont 05101-0440 USA
800-843-2600 • 802-463-9722 • F: 802-463-4059 • www.sonnax.com • info@sonnax.com

©2008 Sonnax Industries, Inc.