

WHAT GOES INTO THE 42-46-47RH/RE

SLIPPAGE IN REVERSE, POOR FORWARD/REVERSE ENGAGEMENT

LINE PRESSURE SLEEVE & PLUG KIT
TF8.VA02 & 22229-04K



TF6.VA01 (FOR A804 ONLY)



PAGE
212


PAGE
212

REVERSE DRUM, PISTON RETAINER & OVERDRIVE FAILURES

IMPROVED FLOW PISTON RETAINERS

STANDARD REPLACEMENTS: 12962N-01K* (42RH/RE) & A518.DRU08* (46-47RH/RE)

OVERSIZED REPLACEMENTS: 12962N-02K* (42RH/RE) & 22754N-02K* (46-47RH/RE)
*PATENTED

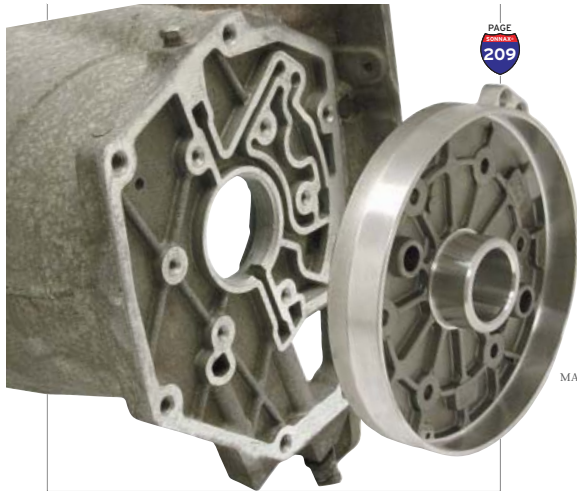


PAGE
209

SHIFT LINKAGE LEAKAGE

MANUAL SHAFT/CASE REPAIR BUSHING
22179-02



REQUIRES TOOL A4LD.TOOL08

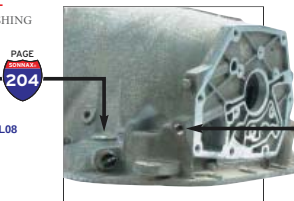

PAGE
204

CRACKED CASE AT COOLER FITTING BOSS

COOLER LINE ADAPTER KIT
22000-01K
5 FITTING ADAPTERS, 1 TAP
COOLER LINE ADAPTER
22000-01

PAGE
215



COOLER LINE
ADAPTER

OEM
FITTING

LOCKUP SHUDDER, OVERHEATED CONVERTER

4-SPOOL SWITCH VALVE
A518.VA01



PAGE
211

DELAYED ENGAGEMENTS, LUBE FAILURE & PR BUZZ

LUBE REGULATED PRESSURE REGULATOR VALVE
TF8.VA04

PATENTED
22771A-07K* (OVERSIZED)



*REQUIRES TOOL 22771A-TL7

PAGE
210

SHIFT TIMING CONCERNS & THROTTLE BUZZ

THROTTLE VALVE KIT

TF8.VA01 (OEM) 22771-HDK (HD + TOWING) 22771-02K* (OVERSIZED)



*REQUIRES TOOL F-22771-TL

PAGE
210

DELAYED ENGAGEMENTS, NO CHARGE IN PARK, PUMP BUSHING FAILURE

MANUAL VALVE
TF8.VA03
PATENTED




PAGE
206

PAGE
213

SOFT OR HARD 1-2 SHIFTS, FORWARD CLUTCH FAILURE

INTERMEDIATE ACCUMULATOR PISTON & SLEEVE
22841-01K

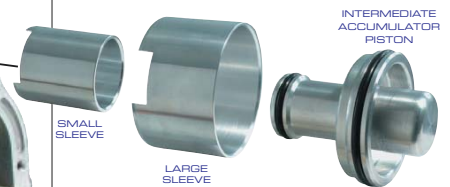

SMALL
SLEEVE

LARGE
SLEEVE

INTERMEDIATE
ACCUMULATOR
PISTON